

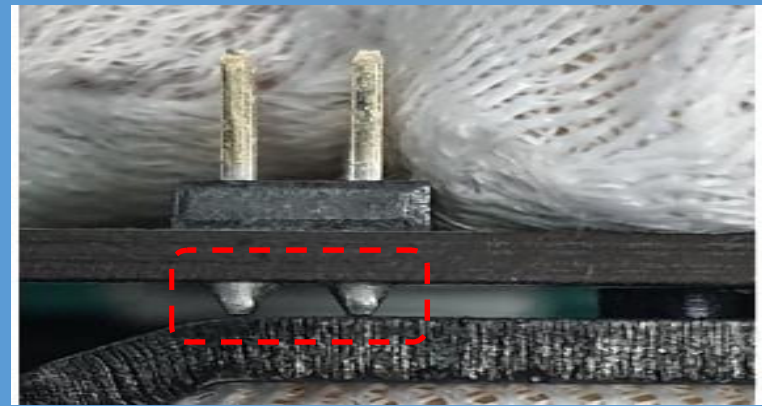


No booting issue_J4 contact issue

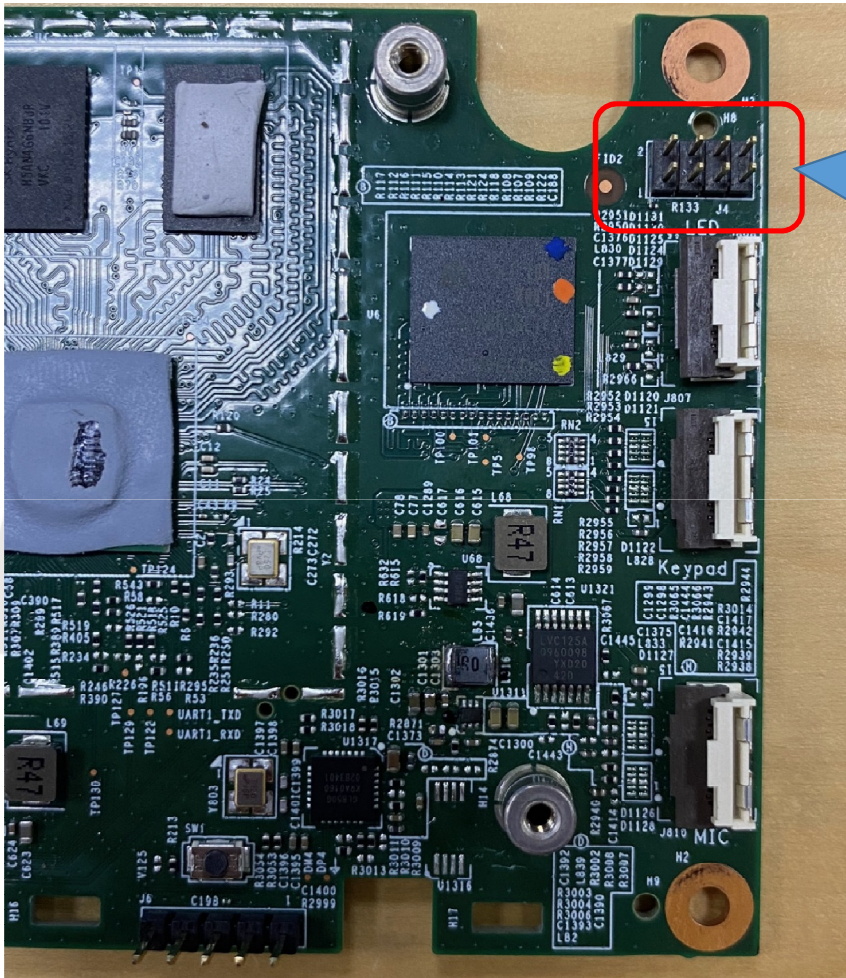

Connection with SPI Key Board

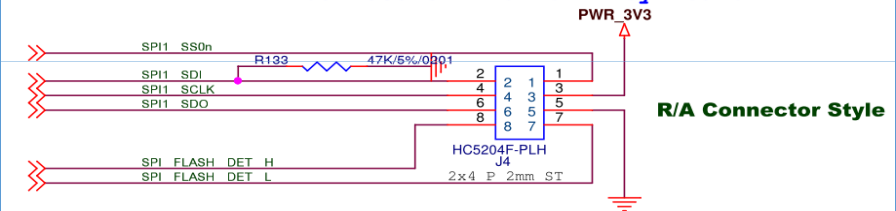

1. The J4 is used for debug port of VS550
2. The J4 pin header is very close to the bottom heat spreader of main board. If J4 is in contact with the heat spreader, the main board may not bootup properly because the 3.3V power short-circuited to ground
3. The leg of pin header changed to normal type in DVT3 build in order to solve the soldering issue on ground pin of pin header. And we will change the pin header to short leg type in MP to prevent the risk of short issue after assembly.