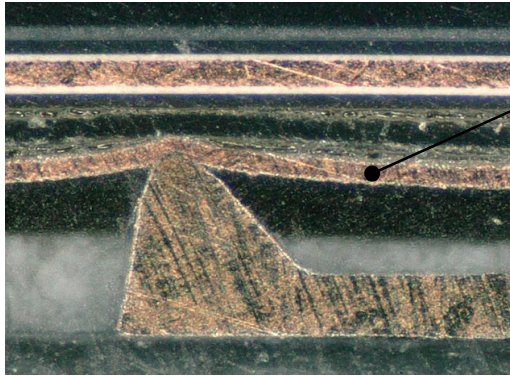


Suspected root cause**①GND PLATE too thin**

GND PLATE thickness		unit: μm
Moter board side	44	
AMC board side	43	

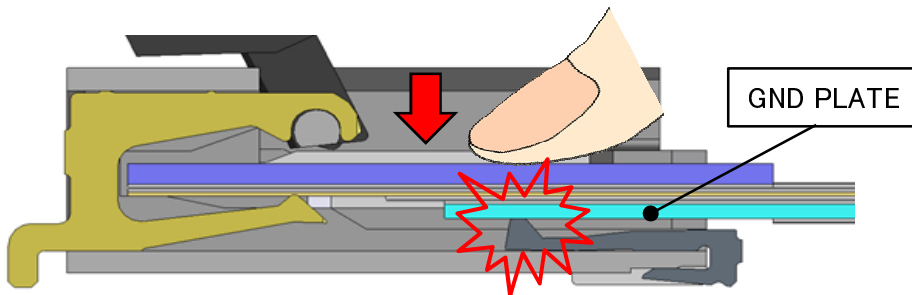
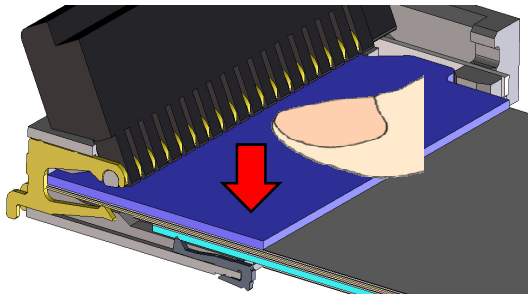
■section view

GND PLATE thickness		unit: μm
HRS recommendation evaluating use	72	



GND PLATE

The GND plate's thickness is only 60% of HRS recommendation.

②Additonal extra force applied when inserting FFC

When inserting FFC, given additional downward force applied directly on FFC(see above), the extra pressure could cause the pierced-thru