

Swan_soundbar_DVT1_review v0.1





ALT Co., Ltd.

Issued Date 2021.02.19



Ver.1.0

Issued by SH, SON

- Gasket for side led attachment NG

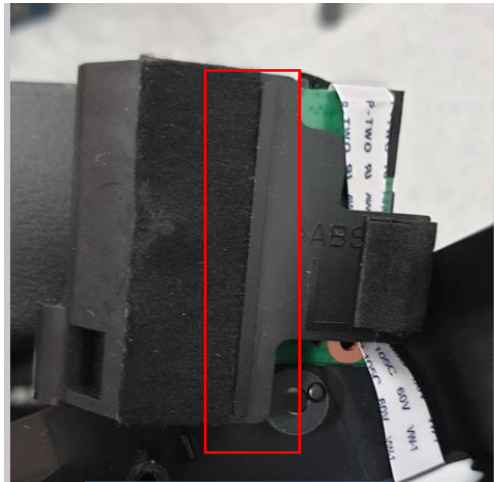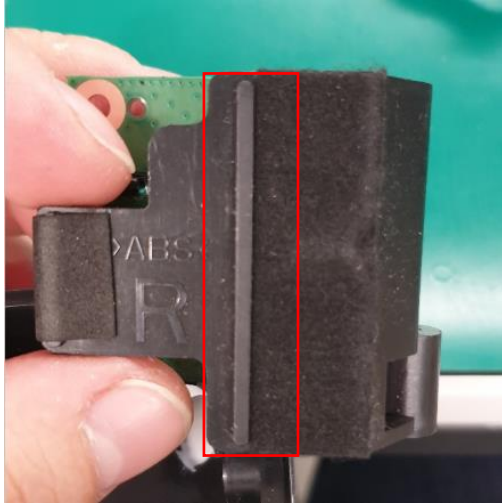


NG

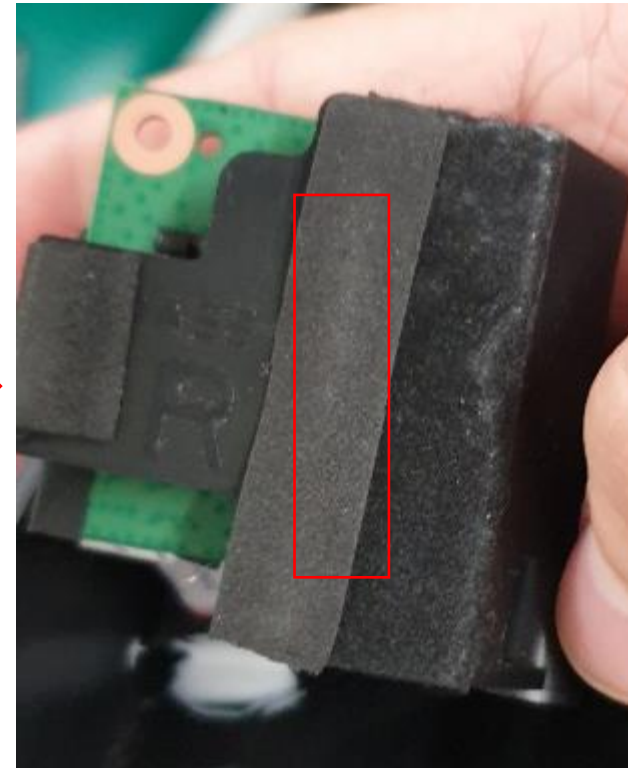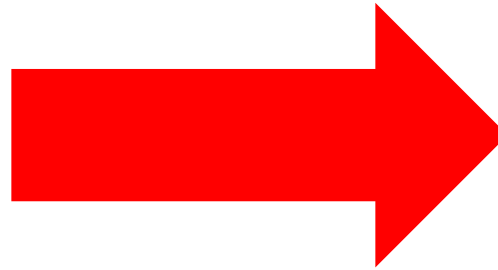

OK

- The Glue is missing on the Ethernet connector side

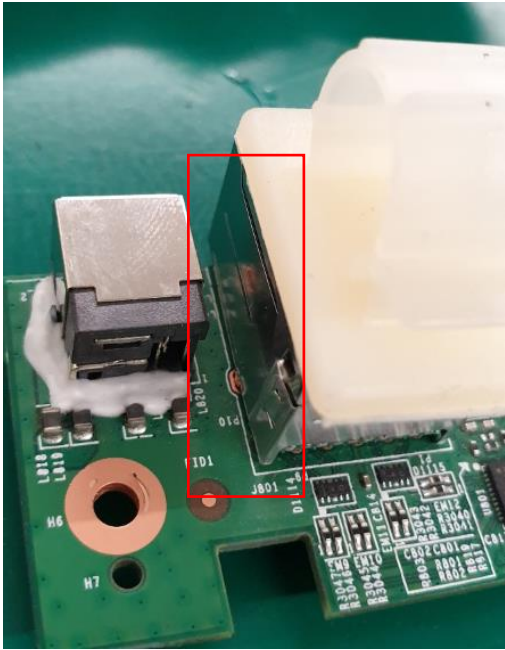

NG



OK

- LED light pipe vibration




NG




OK

- Temporary solution for DVT2
 - Apply glue between LED light pipe and side LED PCB

- Noise and vibration between SOC_BOT heat spreader and bottom housing

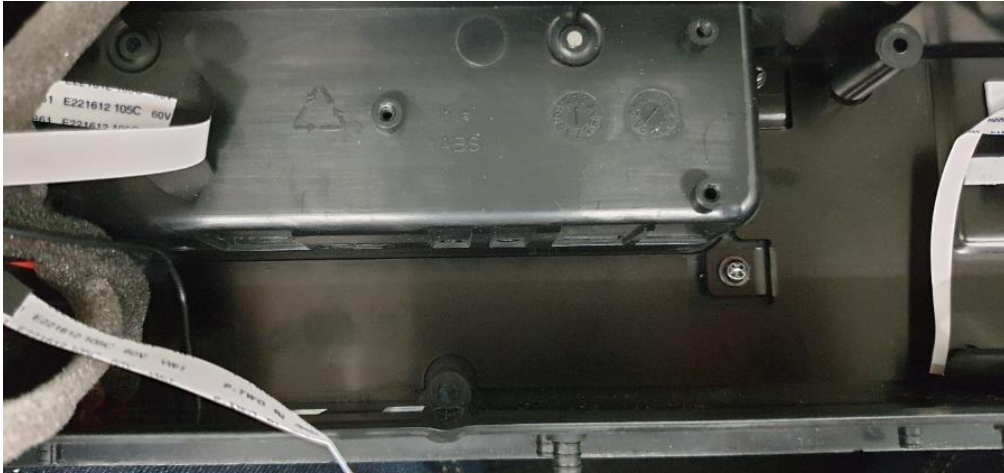


NG

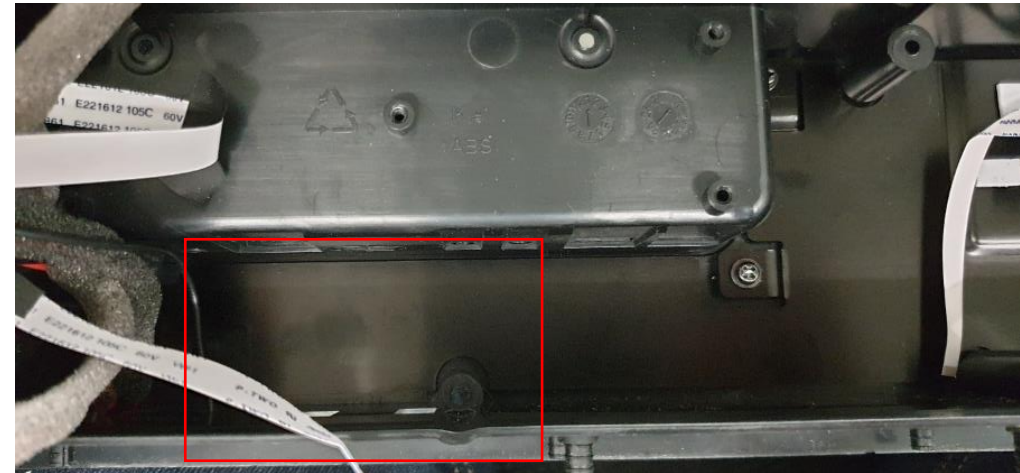

OK

- Temporary solution for DVT2
 - Apply Non-woven between bottom housing and soc_bottom heat spreader

- FFC for side LED folding NG

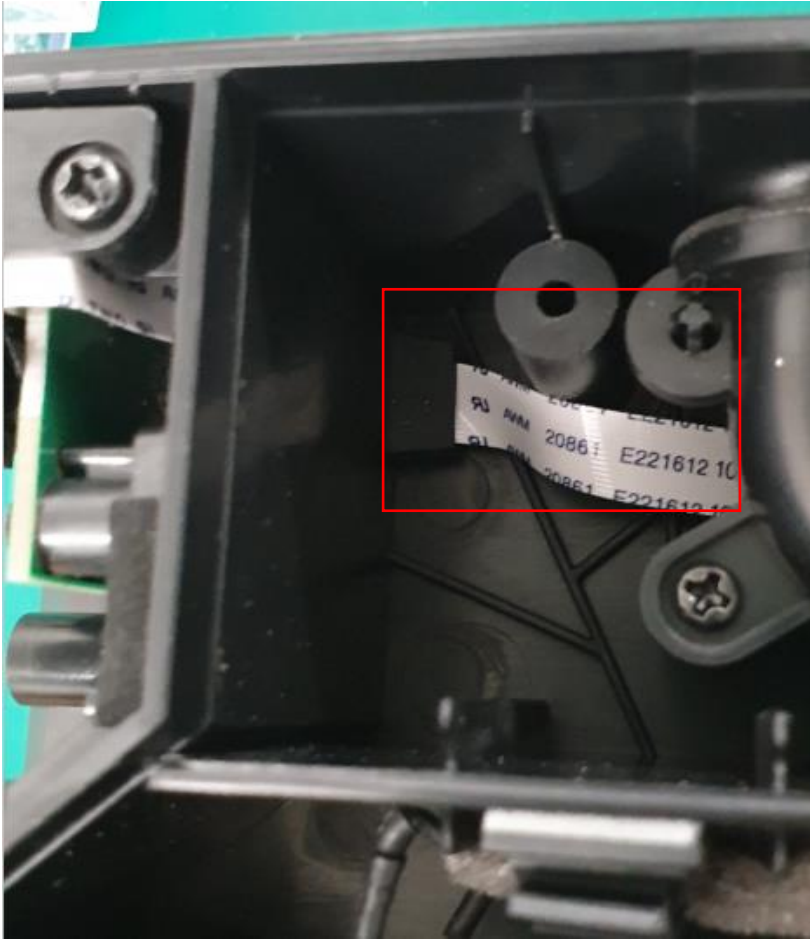

NG




OK

- Temporary solution for DVT2
 - Folding FFC cable like below,
 - To fix the cable to prevent Noise and vibration

- All of cables (FFC, Antenna cable) should be warped with sponge




NG

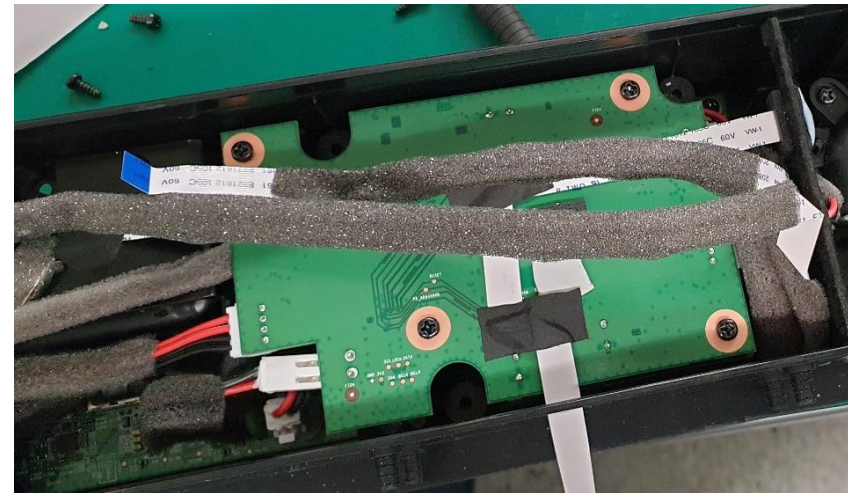


OK

- Side LED bushing : Not to fully sealed.

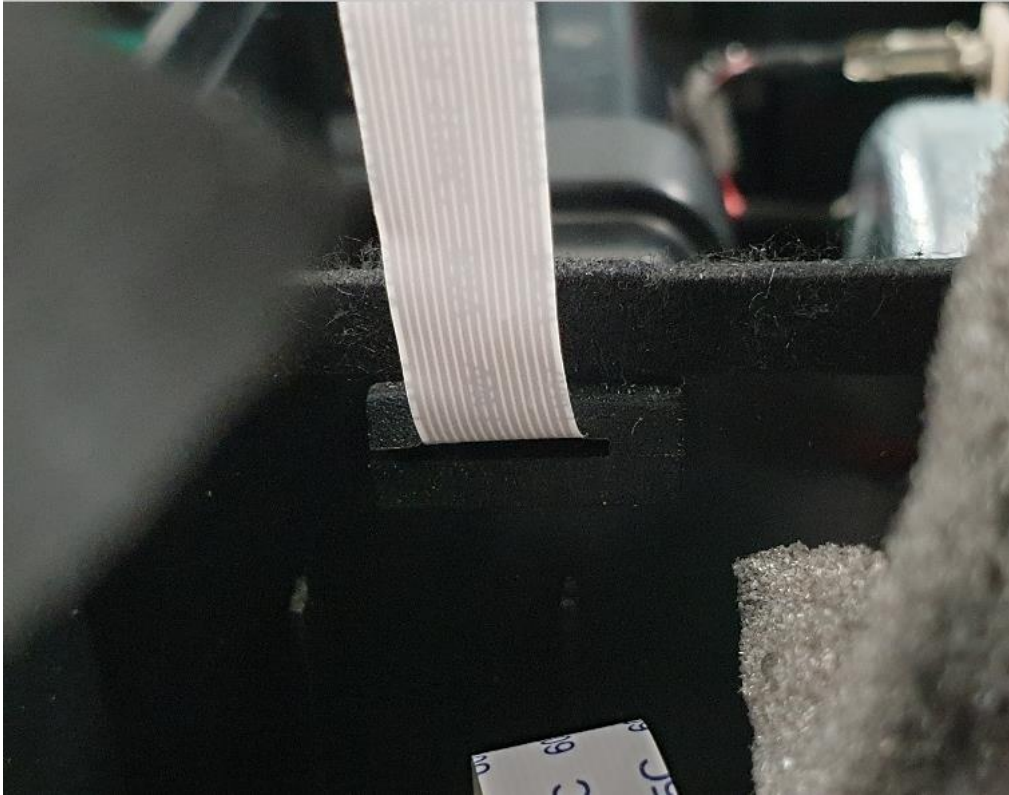

NG

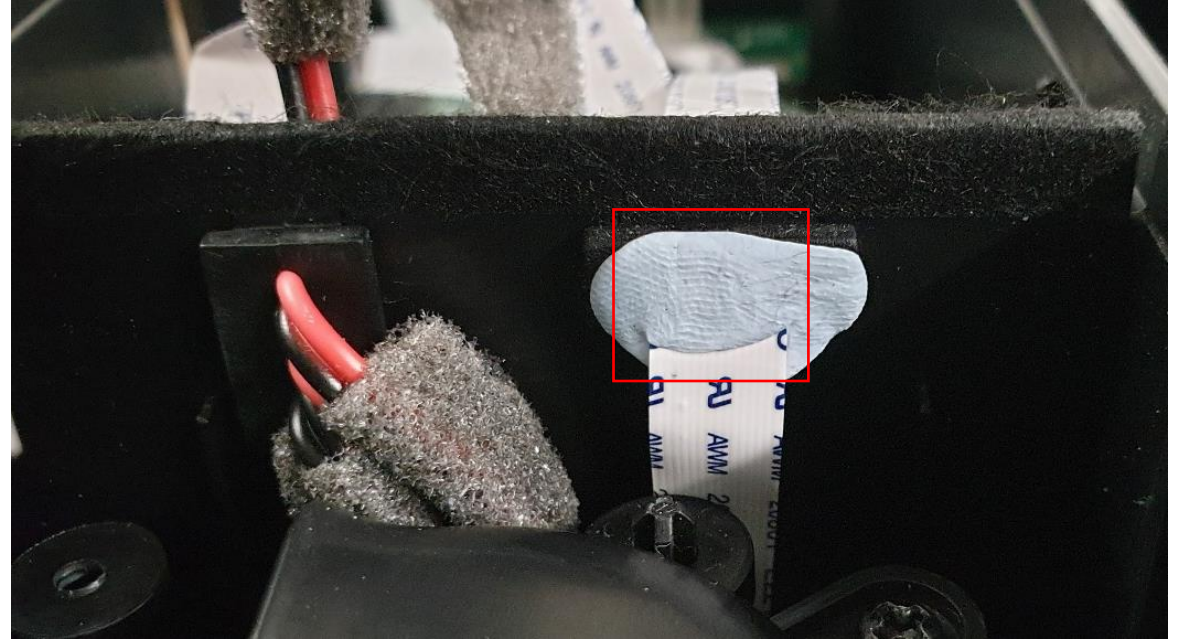

OK

- Temporary solution for DVT2
 - Apply glue instead of clay

- End of Documents